



**ALLSTAR PZL GLIDER**

ul. Cieszyńska 325  
43-300 Bielsko-Biała  
Poland

[techsupport@szdallstar.com](mailto:techsupport@szdallstar.com)

+48 883 008 933

[www.szdallstar.com](http://www.szdallstar.com)

## SERVICE BULLETIN BE-004/54-2/2026

- SAILPLANE:** Type SZD-54 „Perkoz”, model SZD-54-2 „Perkoz”.
- SERIAL NUMBERS  
AFFECTED:** All sailplanes of the SZD-54 "Perkoz" type, model SZD-54-2 "Perkoz", up to and including serial number 542.A.25.049.
- SUBJECT:**
1. Inspection of the airbrake driving torsional tube.
  2. Procedure to follow if damage to the torsional tube is detected.
- COMPLIANCE  
TIME:** Upon receipt of this Service Bulletin.

**ELABORATED BY**  
Responsible for Type Design

*Mariusz Stajewski*

.....  
Mariusz Stajewski

date *24.06.2026*

**APPROVED BY**  
Accountable manager

*Agnieszka Paszyńska*

.....  
Agnieszka Paszyńska

date *24.06.2026*

Issued			Revised			Revision Number
DAY	MONTH	YEAR	DAY	MONTH	YEAR	
26	02	2026	22	06	2026	1

## 1. GROUNDS FOR INTRODUCING THE BULLETIN

Allstar PZL Glider, the holder of the Type Certificate for the SZD-54 "Perkoz" sailplane, has received information from operators of the above-mentioned gliders about the appearance of cracks at the connection of the lever with the torsional tube of the airbrake drive mounted in the fuselage (elements 02 Arm and 01 Connector in drawing 540.64.30.00).

Structural failure or disconnection of the drive components connection may prevent the operation of airbrakes, which could lead to hazardous flight situations.

1 | The analyses and calculations carried out have shown that the area where the lever connects to the torsion tube needs to be reinforced.

## 2. SERIAL NUMBERS AFFECTED

1 | All sailplanes of the SZD-54 "Perkoz" type, model SZD-54-2 "Perkoz", up to and including serial number 542.A.25.049.

## 3. REQUIRED ACTIONS

On sailplanes according to point 2, until the torsion tube assembly is replaced with its reinforced version, general visual inspections (**GVI**) and detailed inspections (**DET**) described in this Service Bulletin should be performed periodically.

1 | Cracks or permanent deformation of the tube and lever (in the area where these components join) or cracks of the welds are not permitted (Figures 1 and 2).

### 3.1. GVI inspections

- 3.1.1. Remove the wings according to the procedure described in the Technical Service Manual, section 2.1, or the Flight Manual, section 4.
- 3.1.2. Using a mirror and a strong light source (flashlight), visually inspect the area where the lever is welded to the torsional tube (item 3 in Figure 1 and the areas susceptible to cracking, as indicated in Figure 2).
- 3.1.3. After inspection, reassemble the wings according to the procedure described in the Technical Service Manual, Section 2.1, or the Flight Manual, Section 4.

Issued			Revised			Revision Number
DAY	MONTH	YEAR	DAY	MONTH	YEAR	
26	02	2026	22	06	2026	1

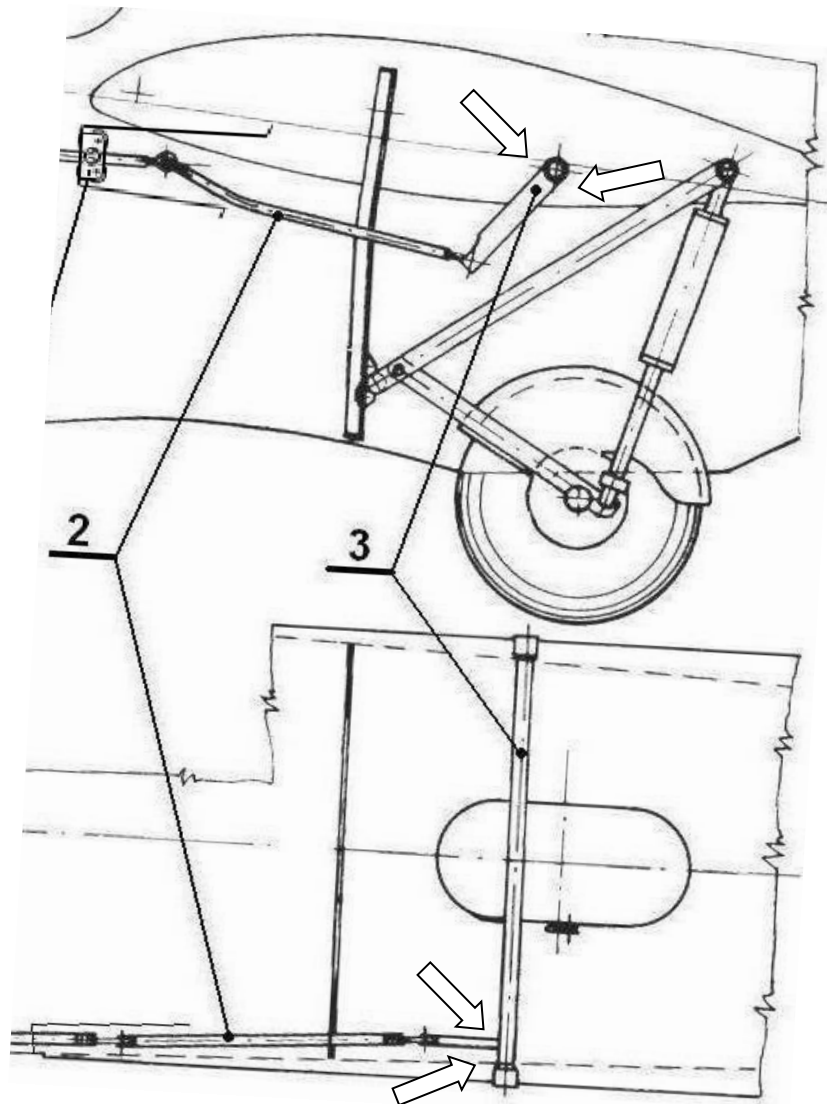


Figure 1 – location of the torsion tube (3) of the airbrake drive in the fuselage.  
The arrows indicate the areas being checked, shown in more detail in Figure 2.

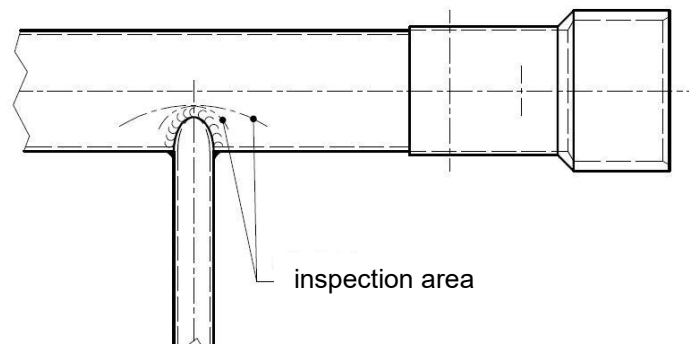


Figure 2 – connection of the lever to the torsional tube of the airbrake control with indication of areas where cracks may appear (on both sides).

Issued			Revised			Revision Number
DAY	MONTH	YEAR	DAY	MONTH	YEAR	
26	02	2026	22	06	2026	1

### 3.2. DET inspections

- 3.2.1. With the wings and rear baggage compartment floor removed, remove the airbrake drive torsional tube assembly.
- 3.2.2. Using a magnifying glass with at least 3x magnification, inspect that there are no cracks in the weld area and around the welded lever-tube joint (Figure 2).
- 3.2.3. If necessary, perform defectoscopy of the areas to be checked - Dye Penetrant Inspection (DPI).
- 3.2.4. Visually check that the tube has retained its cylindrical shape and that there are no permanent deformations.

### 3.3. Inspection schedule

The condition of the torque tube assembly should be checked:

- 3.3.1. For **GVI** inspections - after receiving the bulletin and periodically every 200 take-off operations (with a tolerance of  $\pm 10$  operations)
- 3.3.2. For **DET** inspections - during maintenance work at the level of 12 months or 300 flight hours (according to TSM, p. 16.10).

### 3.4. Inspection performance and certification

- 3.4.1. **GVI** inspection may be performed by a licensed aircraft mechanic, an appropriately approved organization or a pilot with a glider license who is authorized to fly the SZD-54-2 "Perkoz" sailplane.

GVI inspection must be certified in accordance with Commission Regulation (EU) 1321/2014 or in accordance with the national requirements of the country of registration.

- 3.4.2. **DET** inspection may be performed by a licensed aircraft mechanic or an appropriately approved organization.

DET inspection must be certified in accordance with Commission Regulation (EU) 1321/2014 or in accordance with the national requirements of the country of registration.

## 4. POST INSPECTION ACTIONS

- 4.1. If any damage is found, the torsion tube must be replaced with a **new one featuring reinforcements** (consistent with the EASA Major Change Approval No. 10090201).
- 4.2. Once the damaged torsion tube has been replaced with a new, reinforced one, the inspections described in points 3.1 and 3.2 **are not required**; however, the provisions of the Technical Maintenance Manual, Chapter 16, remain in force.
- 4.3. If the inspection reveals no damage to the connection between the lever and the torsion tube (non-reinforced version), the glider may continue to be operated, provided that the inspections described in points 3.1 and 3.2 are carried out in accordance with the inspection intervals set out in point 3.3.

Issued			Revised			Revision Number
DAY	MONTH	YEAR	DAY	MONTH	YEAR	
26	02	2026	22	06	2026	1

## 5. APPENDICES

5.1. None.

## 6. FINAL PROVISIONS

- 1
- 6.1. The parts and components required to replace the torsion tube assembly should be ordered from Allstar PZL Glider (contact: techsupport@szdallstar.com).
  - 6.2. These sets are available for a fee.
  - 6.3. Damaged torsional tubes cannot be repaired or used as spares and must be disposed of.

– THE END –

Issued			Revised			Revision Number
DAY	MONTH	YEAR	DAY	MONTH	YEAR	
26	02	2026	22	06	2026	1